

# CFR The Commercial Flooring Report

For the Commercial Floor Covering Industry

Volume 172 - January 2023

[Click here to View and Download all CFR Newsletters](#)

## What's In The Mix, Again?

The following article was published four years ago. The concrete industry continues to change and we wanted to bring you updates on what's going on. Since the flooring industry doesn't keep close tabs on the concrete industry, even though you may think or be led to believe flooring manufacturers do, and most commercial flooring materials are installed on concrete, you need to know how the changes may affect the integrity of your installations and the flooring products you work with and install.

Concrete substrates are a source of unease for every flooring contractor, manufacturer, and general contractor. The main concern is moisture, but that's not the only thing to be concerned with. Concrete is an alkaline building material which can attack and dissolve flooring adhesives. There is so much more that can compromise a flooring installation lurking in the concrete. You must understand that no two concrete slabs are alike. Whether new or old they vary, and you can't expect any of them to perform the same. Every concrete slab, below, on or above grade, has the potential to contribute to a flooring product or installation failure. What the future holds for concrete mix and design is even scarier, and its' impact on flooring requirements, installation, or performance, no one knows.

In a past issue of Concrete Construction Magazine there were several articles such as controlling concrete construction problems and enhancing concrete with alternative supplementary cementitious materials. Even this is changing now, as the cement market is adopting European product marketing to meet the demand for reduced carbon footprints in the manufacture of cement and using the addition of limestone into Portland Type I cement. Look for this from your local ready mix supplier as IL cement. Limestone is added at levels of up to fifteen percent of the cement content while removing the equivalent Portland offset of fifteen percent. According to the cement industry for every pound of cement manufactured, one pound of carbon dioxide is emitted into the atmosphere. What does this mean at the jobsite level? The cement will now be even wetter due to the extremely finely ground limestone. The one we felt most pertinent to flooring contractors, general contractors, architects and flooring manufacturers, as well as adhesive manufacturers was the article on Moving to Alternative Cements. What does this mean for the aforementioned group? First, let me say this.



Moisture in concrete is the all consuming issue everyone is focused on. What you may not realize is that every concrete slab, that is, every single one of them, is different. There are no two alike and there is no one way to approach each flooring installation as a “one size fits all” project. Your thoughts however and your concerns should also be with the concrete you’re installing the flooring on.

Alternative cements such as Fly Ash and Slag are the result of the concrete industry being under pressure to allow alternatives to supplement Portland cement and employ blended cement mix-designs. The reasons given are: to reduce costs, reduce environmental impact and the need for specific properties that aren’t attainable or possible with ordinary Portland cement concrete.

We just mentioned one of the big changes above, but there are a slew of newer materials (both organic and inorganic) coming onto the market which include, but are not limited to, geopolymers, activated glassy cements, and others. There is no way of knowing what effect these changes, which are indeed being made and coming down the pike, will have on the concrete you’ll be installing on. Some of the organic products are additives to dose the ready mix for purposes beyond the scope of my newsletter with the acronyms PAM and PEG. You might want to remember these acronyms. PAM stands for *POLY ACRYLAMIDE* which is an admixture added to ready mix which for lack of better words, makes water wetter. PEG is *POLY ETHYLENE GLYCOL* similar to the antifreeze you add to your car which acts as kind of an oil in concrete and retains the water in the concrete after it cures and does not seem to allow humidity to drop to acceptable or normal levels.

If this material leaches out of concrete nothing is going to stick to it and you may have no idea what’s going on if the installation should fail and/or the flooring material is affected. Nor is there any way for you to tell what’s in the mix you’re dealing with, without a forensic analysis of the Division 03 Concrete scope. In all of the information provided there is no comment or concern for how flooring installation on these slabs will be affected. This is understandable since the concrete industry is focused on their issues and not yours and there is virtually no dialogue between the concrete industry and the flooring industry. Try explaining why you have FF and FL finishing standards in division 3 and a ten foot straight edge used to determine an 1/8” in 10’ in division 9. In addition to the alternative cements is alternative aggregates, and this includes recycled materials which can include crushed hydraulic cement concrete or recycled aggregate. From your



## **THE COMMERCIAL FLOORING REPORT**

**Lewis G. Migliore—President**

**P: 706.370.5888 or Email: [lgmtcs@optilink.us](mailto:lgmtcs@optilink.us)**

**Just Click Here to Go to Our Website for All CFR Articles**

**[LGMANDASSOCIATES.COM](http://LGMANDASSOCIATES.COM)**

## ***LGM* and Associates**

**Experts in Everything Flooring  
From Substrates to Surfaces**

**No Issue is too Big, too Small or  
too Far Away for Us to Handle**

**Free Initial Consultation**

**Complaint Determination, Consulting,**

**Resolution of Flooring Issues**

**Concrete/Moisture Issues and**

**Certified Product Testing**

**Dispute Resolution, Legal/Litigation**

**Assistance, and Proffered Expert Witness**

**Project Assistance**

**Develop Flooring Specifications and**

**Product Sample Evaluation**

***“When No One Else has Answers,***

***We Do”***

*Just click the image below or search under  
Lew Migliore and let’s connect on LinkedIn!!*

**Linked in**

**FLOOR  
COVERING  
INSTITUTE**

**Professional  
Testing  
Laboratory  
Inc.**

***fuse***  
COMMERCIAL FLOORING ALLIANCE

**starnet** ★  
worldwide  
COMMERCIAL FLOORING PARTNERSHIP

**CRI**  
THE CARPET AND RUG INSTITUTE

Page Layout By: Anita S. Drennon

experience installing virgin and recycled flooring products, do you think there may be unforeseen issues that result from recycled concrete components? All of these changes have to meet requirements for structural and durability properties. These changes have an effect on the water/cementitious materials ratio. Again, this can have an effect on your flooring project. None of this information, as it enters the concrete industry and gets used, is going to be known to the flooring contractors and even if it was, you're not going to know anything about what it means and how it may affect your installation. And far be it for the flooring manufacturers of any type of product or those ancillary products used, such as adhesive, to know this either. So, if you think moisture is an issue, get ready for the onslaught in the variations in the new concrete.

In scaring you, let me share a recent project we were involved in. This is a brand new building, several stories high, where the flooring installed was exhibiting areas losing adhesion. When our concrete associates, who I consider some of the very best in the business, finished reviewing the concrete specifications, batch tickets, concrete mix design and all other pertinent materials, as well as analyzing the results of the core samples taken and tested, we found a component on the concrete surface that was acting as a bond-breaker and had compromised the installation. The independent testing agent for the General Contractor stated in their prior report that the bond-breaker on the surface was unremoved curing compound. Naturally the GC blamed the flooring sub-contractor since flooring manufacturer guidelines all read "surface must be free of bond-breaking contaminants including curing compounds, etc." Through analytical testing we were able to confirm the material was not a curing compound, but was the super-plasticizer used as an admixture in the concrete. Prior to our involvement the flooring contractor was being blamed for a problem that wasn't his. This is the type of situation you guys may be finding yourselves in down the road with the changes on the way. Consequently, you're going to need to find someone that can help you steer clear of these mine fields, that knows and understands this stuff and knows what and how to look for it. I will tell you; this is very heady stuff and once our guys get into it, they start speaking a language they have to interpret for me.

If you are not looking at Division 03 specifications to identify specialty admixtures, tilt-wall construction applications, topical curing membranes and other alternative concrete processes you may be installing on dangerous ground. Many well-versed flooring contractors



# FLOORCLOUD™

Now You Know

## View remote, real-time, climate readings direct from your jobsite...to reduce risk!




- No Wi-Fi needed
- Receive and share "out-of-specifications" alert notifications
- Capture & archive key site information
- Report Generation
- Contact us for more information & a free 30 day trial!

[floorcloud.com](http://floorcloud.com)  
 617.395.1668  
[support@floorcloud.com](mailto:support@floorcloud.com)





**ALWAYS LOOK OUTSIDE**  
PART OF THE SLAB IS ON GRADE AND PART BELOW DUE TO THE GRADING OF THE BUILDING

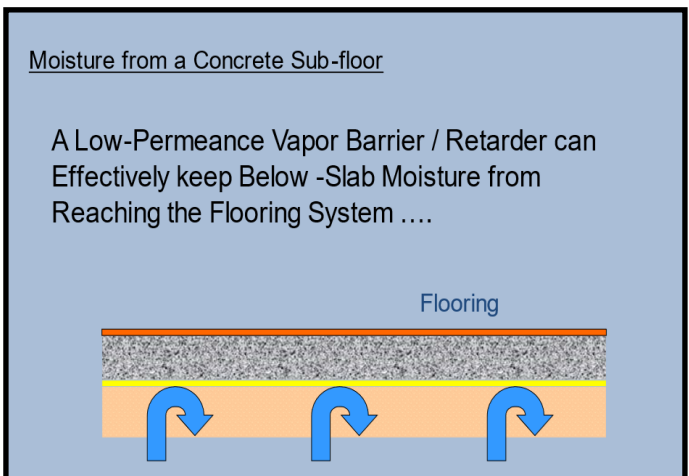

**THIS DIAGRAM SHOWS WHERE THE MOISTURE VAPOR BARRIER/RETARDER MUST BE PLACED, DIRECTLY UNDER THE CONCRETE, TO BE EFFECTIVE.**

are routinely evaluating some or all of these components to red flag potential issues prior to acceptance of the substrate. Since flooring manufacturers will not warrant products installed over (sacrificial) curing membranes it is critical to identify up-front how concrete is cured and what additional processes will be needed to insure a compliant installation substrate. There are many specialty admixtures or treatments for concrete that may render the surface non-porous or contain soluble bond-breaking materials such as sodium or potassium silicates. There are many resources available identifying the risks associated with installation on concrete treated with these chemicals. Manufacturers are also starting to publish written statements that their warranties will be voided if products are installed over these known bond-breaking treatments.

In addition, how the concrete finisher trowels the concrete surface, also, has an impact on moisture, how moisture is retained and released or not released from the newly poured concrete. If the concrete finisher spends an excessive amount of time on the concrete slab trying to meet his finish standards, he can literally turn the concrete cap into a burnished surface where nothing gets in or nothing gets out. The concrete surface will not wet out and will require mechanical surface preparation to have the surface conditions meet ASTM F 3191.

Some concrete finishers will burnish the surface of the concrete to the point where if you pour water on the concrete, it will not go into the concrete and wet out, but just sit there until it evaporates.



The number of issues that can arise from treatments or processes implemented during division 03 concrete work, adversely affecting flooring installations are too numerous to review here. But beyond delamination failures, loss of manufacturer warranties and potential incompatibilities there are many more subtle issues to be cognizant of. Concrete slabs treated with reactive silicate products typically render the surface non-porous and non-absorptive. Since porosity allows for water absorption during flash time of adhesives, rendering the surface non-porous dramatically affects a glue's ability to flash and adhere. We have seen many cases where the glue never fully coalesced on an installation and was deemed an installation error. However, an adhesive may allow for only 10 to 15 minutes flash time and carry warnings that allowing to flash too long will prevent sufficient adhesion. Well-seasoned installers using familiar materials, in familiar conditions getting differing results? The variable is the installation substrate. While the industry is trying to drive pricing down, the stakes are getting higher, and responsibility becomes greater. In today's liability shell game, flooring contractors need to be more aware than ever of the potential pitfalls they face every day. Many of them have nothing to do with the flooring itself. Since most commercial flooring is installed on concrete, it is more important than ever to be aware of what's in the mix and could affect your work, reputation, and bottom line.

If you think flooring manufacturers have any knowledge of what lurks in the concrete that can compromise an installation or their product, think again. There is no one employed by any manufacturer, of any flooring products, that is aware of the science or chemistry that may affect their products in the field. Just look at the arbitrary guidelines for moisture in concrete stated by manufacturers who basically follow each other down the path of throwing out numbers that are virtually guesses. At least moisture in concrete can be detected and measured. You have no idea what's hiding in plain site when you look at a concrete slab. The people who develop the moisture standards for concrete have not adequately addressed the pH issue of concrete or the products applied to concrete. Always remember moisture is an issue, but what is more of an issue is pH. You cannot have pH without having moisture present. When pH levels rise to certain thresholds, flooring materials can be chemically compromised into premature failures. Again, to further complicate the moisture issues, the people who write these moisture standards are not communicating with the cement industry to find out just how the latest changes in their industry affects the end

result in the flooring industry.

We're seeing more and more flooring failures and issues as a result of the flooring industry making statements their products can't keep. People are spewing inaccuracies and the flooring contractors and installers are getting blamed for doing something wrong. For an industry that's crying about training and keeping installers there's a lot of blame being placed on the guys installing the product when the product itself may be to blame. This is not a good way to build relationships. Let me shock you by saying, every product or installation failure is not the result of the installation, and this is truer now with the flood of vinyl plank and tile products. Quite frankly, most of the failures of these products is a product problem. It's hard to mess up the installation of a product that you take out of a box in pieces and place on the floor with or without glue. It's not like having to install an intricate patterned piece of carpet that must be placed, matched, trimmed, edge sealed, seamed, and stretched in. That's much easier to mess up than putting a piece of vinyl flooring down.

To be sure, we're going to be seeing more challenges installing over concrete quite simply because there will be so many varieties of components in the mix. You're not going to know that they are there, and when they do compromise an installation, what you have to do about it. One thing is certain. Flooring contractors don't mix, pour, or place the concrete and have nothing to do with what goes into it. If the flooring failure can be traced to the concrete, which it could be, you're going to need someone who can determine that. Fortunately, we can do that and we have, many times. So, if the information in this newsletter has you shaking your head, know that we're always here to help you. We can always determine what went wrong, why, who's at fault and how to fix and resolve a flooring failure - always.

**LGM** and Associates – **Lew Migliore**

**Experts in Everything Flooring from Substrates to Surfaces**

***Free Initial Consultation***

**Email: [lgmtcs@optilink.us](mailto:lgmtcs@optilink.us) - Office: 706-370-5888**

**Right Product in the Right Place: Get it in the Door; Keep it on the Floor  
Project Assistance, Develop Flooring Specifications and Product Sample Evaluation**

**Consulting, Determination, Resolution of Flooring Issues, Concrete/Moisture Issues and  
Certified Product Testing**

**Dispute Resolution, Legal/Litigation Assistance, and Proffered Expert Witness**

***"When No One Else has Answers, We Do"***

# Commercial Flooring Report

## Ad Size and Pricing

519 Oxford Street • Dalton, GA 30720—lgmtcs@optilink.us—706.370.5888

CFR Provides the most Coverage and Best Value for Your Advertising Dollar

Link to Your Website is Embedded in Your Ad

All Three Ad Sizes Can be Customized to Your Liking

Free to Recipients - Sharing and Posting to Your Website is Encouraged

Pertinent and Relevant Information in Each CFR Issue

Totally Green – No Paper Used for Publication

Over 100,000 plus Readers and Growing

Archived on [LGMandAssociates.com](http://LGMandAssociates.com) and other Websites

Just Click Here 

Ad Size—1" x 2"

\$ 4,000—12 Issues

\$ 335—per Issue

Ad Size—3.5" x 3.5"

\$ 6,000—12 Issues

\$ 500—per Issue

Ad Size—5" x 3.5"

\$ 9,600—12 Issues

\$ 800—per Issue



## Does Your Warehouse Look Like This??

Is Warehouse Space an Issue?



Call Us to turn Your Excess Inventory into

# CASH!!!



[surplus@overstockfloorzusa.com](mailto:surplus@overstockfloorzusa.com)

**Kolt Privett - 770-530-4709**

We prefer broadloom, carpet rems, carpet tile and LVP